



INDUSTRIAL PEDESTAL DRILL PRESS

Model **DP20**

INDUSTRIAL BENCH DRILL PRESS

Model **DB20**

INSTRUCTION MANUAL



For your safety, read all instructions carefully.

ISO-9001:2008 Certified

WARNING

Some dust created by power sanding, sawing, grinding, drilling, and other construction activities contains chemicals known to the State of California to cause cancer, birth defects or other reproductive harm. Some examples of these chemicals are:

- Lead from lead-based paints.
- Crystalline silica from bricks, cement, and other masonry products.
- Arsenic and chromium from chemically treated lumber.

Your risk from these exposures varies, depending on how often you do this type of work. To reduce your exposure to these chemicals: work in a well ventilated area, and work with approved safety equipment, such as those dust masks that are specially designed to filter out microscopic particles.

Table Of Contents

	PAGE
1. SAFETY	
SAFETY RULES FOR ALL TOOLS.....	4
ADDITIONAL SAFETY INSTRUCTIONS FOR DRILL PRESS	5
2. INTRODUCTION	
UNPACKING	7
PIECE INVENTORY	7
CLEAN UP.....	8
SITE CONSIDERATIONS	8
3. ASSEMBLY	
BEGINNING ASSEMBLY	9
COLUMN/BASE.....	9
TABLE SUPPORT.....	9
HEADSTOCK	11
HANDLES	11
INSTALLING LIGHT BULB	11
DRILL CHUCK AND ARBOR	11
ARBOR REMOVAL	12
4. ADJUSTMENTS	
SPEED CHANGES	12
DEPTH STOP	13
TABLE ADJUSTMENTS	14
5. OPERATIONS	
TEST RUN.....	15
DRILL BIT CHANGES.....	15
6. MAINTENANCE	
GENERAL	16
TABLES.....	16
LUBRICATION.....	16
V-BELT	16
7. TECHICAL DATA	17
8. PARTS LISTS & EXPODED VIEWS	17--22

1: SAFETY

Safety Instructions For Power Tools

For Your Own Safety Read Instruction Manual Before Operating This Equipment

1. Keep work area clear. Cluttered areas and benches invite injuries.
2. Consider work area environment . Do not expose tools to rain. Do not use tools in damp or wet location. Keep work area well lit .Do not use tools in the presence of flammable liquids or gases.
3. Guard against electric shock. Avoid body contact with earthed or grounded surfaces.(e.g. pipes ,radiator ,ranges ,refrigerators).
4. Keep other person away. Do not let persons ,especially children, involved in the work touch the tool or the extension cord and keep them away from work area.
5. Store idle tools. When not is use , tools should be stored in a dry locked up place ,out of reach of children.
6. Do not force the tool. It will do the job better and safer at the rate for which it was intended.
7. Use the right tool . Do not force small tools to do the job of a heavy duty tool. Do not use tools for purposes not intended, for example do not use circular saws to cut tree limbs or logs.
8. Dress properly. Do not wear loose clothing or jewellery, they can be caught in moving parts. Non-skid footwear is recommended when working outdoors . Wear protective hair covering to contain long hair.
9. Use protective equipment .Use safety glass. Also use face or dust mask if cutting operations is dusty.
10. Connect dust extraction equipment. If devices are provided for connection of dust extraction and collection facilities ensure there are connected and property used.
11. Do not abuse the cord. Never yank the cord to disconnect it from the socket. Keep the cord away from hear , oil and sharp edges.
12. Secure work. Where possible use clamps or a vice to hold the work. it is safer than using your hands.
13. Do not overreach. Keep proper footing and balance at all times.
14. Maintain tools with care . Keep tools sharp and clean for better and safer performance. Follow instruction for lubricating and changing accessories. Inspect tool cords periodically and if damaged have them repaired by an authorized service facility . Inspect extension cords periodically and replace if damaged .Keep handles dry, clean and free from oil and grease.
15. Disconnect tool, When not in use , before servicing and when changing accessories such as blades, bit and cutters, disconnect tools from the power supply.
16. Remove adjusting keys and wrenches. Form the habit of checking to see that keys and adjusting wrenches are removed from the tool before turning it on.
17. Avoid unintentional starting . Ensure switch is "off" position when plugging in.
18. Use outdoor extension leads. When tool is used outdoor only extension cords intended for outdoor use and so marked.
19. Stay alert. Watch what you are doing , use common sense and do not operate tool when you are tired.
20. Check damaged parts . Before further use of the tool, it should be carefully checked to determine that it will operate properly and perform its intended function. Check for

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

alignment of moving parts, breakage of parts, mounting and any other condition that may affect its operation. A guard or other part that is damaged should be properly repaired or replaced by an authorised service centre unless otherwise indicated in this instruction manual. Have defective switches replaced by an authorised service center. Do not use tool if switch does not turn it on and off.

21. Warning: the use of any accessory or attachment other than an recommended in this instruction manual may present a risk of personal injury.
22. Have your tool repaired by a qualified person. This electric tool complies with the relevant safety rules. Repairs should only be carried out by qualified persons using original spare parts, otherwise this may result in considerable danger to the user.
23. Save these instructions.

Additional Safety Instructions For Drill Presses

1. **ALWAYS OPERATE YOUR DRILL PRESS AT SPEEDS** that are appropriate for the drill bit size and the material that you are drilling.
2. **FEED THE DRILL BIT EVENLY INTO THE WORKPIECE.** Back the bit out of deep holes and clear the chips with a brush after you have turned the machine off.
3. **MAKE SURE THE DRILL BIT YOU ARE USING IS TIGHTENED PROPERLY.** Use only round, hex or triangular shank drill bits.
4. **NEVER DO MAINTENANCE OR CHANGE SPEEDS WITH THIS MACHINE PLUGGED IN.**
5. **NEVER USE TOOLS THAT ARE IN POOR CONDITION.** Cutting tools that are dull or damaged are difficult to control and may cause serious injury.
6. **NEVER DRILL SHEET METAL UNLESS IT IS CLAMPED SECURELY TO THE TABLE.**
7. **WORK SHOULD BE POSITIONED IN SUCH A WAY AS TO AVOID DRILLING INTO THE TABLE.**
8. **A FACE SHIELD USED WITH SAFETY GLASSES IS RECOMMENDED.**
9. **ALWAYS CLAMP WORKPIECE SECURELY TO TABLE BEFORE DRILLING.** Never hold a workpiece by hand while drilling.
10. **IF AT ANY TIME YOU ARE EXPERIENCING DIFFICULTIES** performing the intended operation, stop using the machine! Then contact our service department or ask a qualified expert how the operation should be performed.
11. **REMOVE ADJUSTING KEYS AND WRENCHES.** Before turning the machine on, make it a habit to check that all adjusting keys and wrenches have been removed.
12. **HABITS—GOOD AND BAD—ARE HARD TO BREAK.** Develop good habits in your shop and safety will become second-nature to you.

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

2: INTRODUCTION

Unpacking

If moving this machine up or down stairs, the machine must be dismantled and moved in smaller pieces. Make sure floor and stair structures are capable of supporting the combined weight of the machine parts and the people moving them

The Drill Press is shipped from the manufacturer in a carefully packed carton. If you discover the machine is damaged after you've signed for delivery, immediately call Customer Service for advice.

When you are completely satisfied with the condition of your shipment, you should inventory its parts.

Piece Inventory

A full parts list and breakdown can be found toward the end of this manual. For easier assembly, or to identify specific parts, please refer to the detailed illustrations at the end of the manual.

After all the parts have been removed from the carton, you should have:

- Headstock
- Table Assembly
- Base
- Column Assembly
- Drill Chuck and Key
- Drift Key
- Hex Bolts, M10 x 25 or 40 (4)

In the event that any nonproprietary parts are missing (e.g. a nut or a washer), we would be glad to replace them, or, for the sake of expediency, replacements can be obtained at your local hardware store.



Figure 2A

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

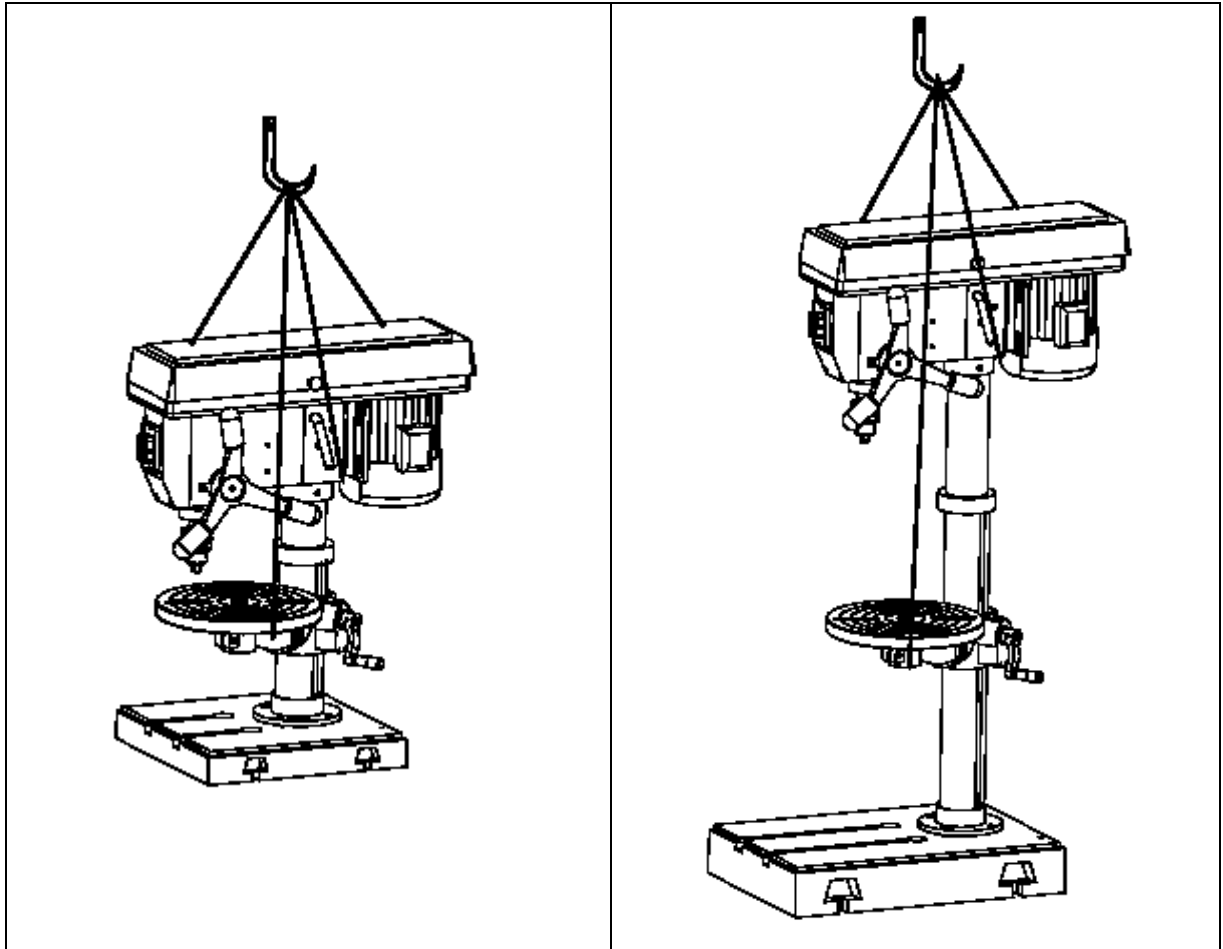


Figure 2B

Figure 2C

Attention: Use a hoist to handle the main frame of the machine. shown in **Figure 2B & Figure 2C**

Clean Up

The unpainted surfaces are coated with a waxy oil to protect them from corrosion during shipment. Remove this protective coating with a solvent cleaner or citrus-based degreaser . Avoid chlorine-based solvents as they may damage painted surfaces should they come in contact. Always follow the usage instructions on the product you choose for clean up.

Site Considerations

FLOOR LOAD

Your drill press represents a moderate weight load in a small footprint. Most commercial or home shop floors should be sufficient to carry the weight of the drill press. If you question the strength of your floor, you can opt to reinforce it. Ensure that the stand or bench you use with the drill press is capable of supporting the machine.

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

WORKING CLEARANCES

Working clearances can be thought of as the distances between machines and obstacles that allow safe operation of every machine without limitation. Consider existing and anticipated machine needs, size of material to be processed through each machine, and space for auxiliary stands and/or work tables. Also consider the relative position of each machine to one another for efficient material handling. Be sure to allow yourself sufficient room to safely run your machines in any foreseeable operation.

LIGHTING AND OUTLETS

Lighting should be bright enough to eliminate shadow and prevent eye strain. Electrical circuits should be dedicated or large enough to handle combined motor amp loads. Outlets should be located near each machine so power or extension cords are not obstructing high-traffic areas. Be sure to observe local electrical codes for proper installation of new lighting, outlets, or circuits.

3: ASSEMBLY

Beginning Assembly

Most of your Drill Press has been assembled at the factory, but some parts must be assembled or installed after delivery. We have organized the assembly process into steps. Please follow along in the order presented here.

Column/Base

Drill press must be secured to the floor using anchor bolts, or the base should be secured to a piece of plywood.

1. Unplug machine before assembly.
2. Secure the base to the floor using the appropriate anchor bolts.
3. Place the column on the base and line up the mounting holes. Insert and tighten the M10-1.5 hex head bolts with a wrench.

Table Support

1. Thread the 12mm table lock handle 3 turns into the table support bracket as shown in **Figure 3**.
2. Insert the pinion gear into the hole on the side of the table support bracket from the inside, starting with the pinion shaft as shown in **Figure 3**. Align setscrew in crank handle with flat on pinion gear shaft and secure using the 3mm Allen® wrench provided as shown in **Figure 4**.
3. Examine the rack and note that the gear teeth extend farther on one end than the other. The end of the rack where the gear teeth are closest to the end should be positioned down. Insert the rack into the table support bracket and align it with the pocket as shown in **Figure 4**. The gear teeth on the rack must also face out.

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

- Slide the table support bracket onto the column while holding the rack in place. Allow the bracket to go down until the bottom of the rack contacts the shoulder on the column support as shown in **Figure 4**. Secure the table support bracket with the lock handle.

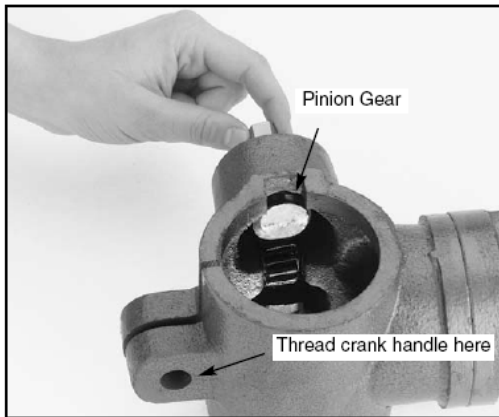


Figure 3



Figure 4

- Slide the column ring onto the column with the inside bevel in the down position as shown in **Figure 5**. Adjust the ring until the tip of the rack fits inside the bevel. Tighten the setscrew on the ring.



Figure5

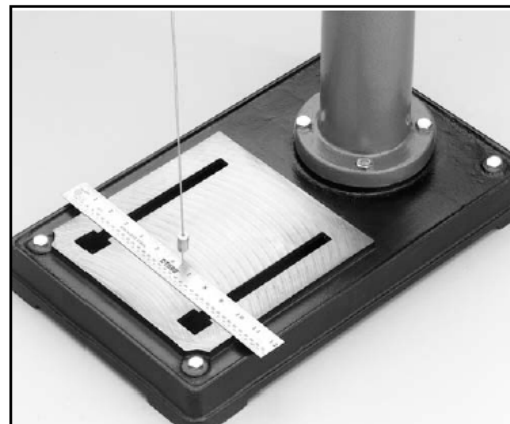


Figure6

Headstock

- There is a pocket in the bottom of the headstock for the column to be placed. Seek assistance to help position the headstock over the column. Allow the headstock to slide down until it stops (approximately 4").
- Position the headstock directly over the base by using a plumb bob. Use a measuring tape or ruler across the drill press base to find its center. Suspend the plumb line from the center of the headstock label and lower the bob until it is near the tape/ruler as shown in **Figure 6**. Adjust headstock from side to side until the tip is equidistant from both the left and right sides.
- Tighten the two head Locking screws shown in **Figure 7** to secure headstock to the

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

column.

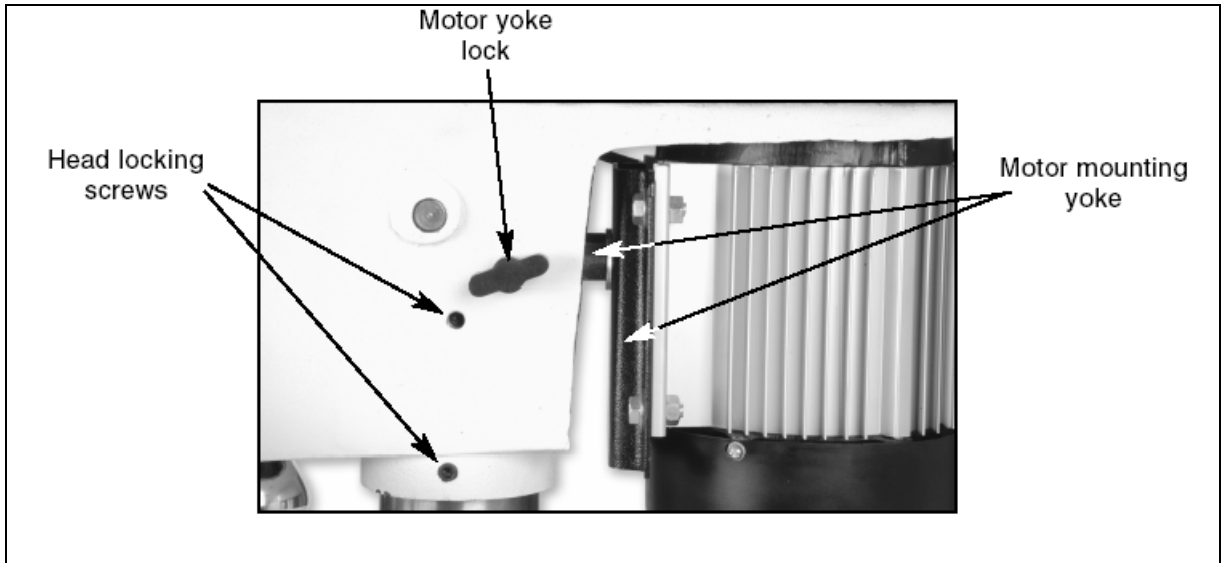


Figure 7

Handles

Three handles are supplied with the drill press. Thread them into the handle hub.

Installing Light Bulb

The drill press has a light socket that utilizes standard sized 40watt bulbs. Before installing a light bulb, unplug the drill press. Secure bulb in opening behind the spindle.

Use only bulbs that are “safety coated” and shatter resistant. The bulb will be exposed at the bottom of the head casting which helps with illumination. Impacts with a bulb not “safety coated” may shatter, exposing the electrical filaments and creating an electrical shock hazard.

Drill Chuck and Arbor

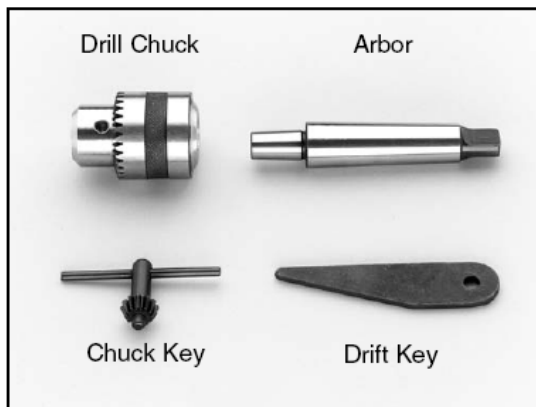


Figure8



Figure 9

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

The drill chuck attaches to the drill spindle by means of a drill chuck arbor. Matched tapers on the arbor and back of the chuck create an almost permanent assembly when properly joined. **Figure 8** To assemble the drill chuck and mount it to the spindle, carefully follow the instructions below:

1. The drill chuck, arbor and spindle socket must be thoroughly cleaned and dried before assembly. It is recommended that mineral spirits be used for this task. Refer to the safety warnings on the container of the mineral spirits. **Failure to clean the mating surfaces may result in separation and an unsafe condition.** Separation is usually caused by oil or grease on the taper.
2. Use the provided chuck key to adjust the jaws of the chuck until they are well inside the drill chuck body.
3. Place the drill chuck on a workbench face down. The arbor has a short taper and a long taper. Place the short taper into the socket in the back of the drill chuck and tap with a rubber or wooden mallet as shown in **Figure 9**. If the chuck fails to remain secure on the arbor, repeat **step 1 and 2**.
4. Slide the arbor into the spindle socket while slowly rotating drill chuck. The socket has a rectangular pocket in which the tang (or flat portion of the arbor) fits into. Once the tang is oriented correctly the drill chuck will not rotate without turning the spindle.
5. Tap the end of the drill chuck with a rubber or wooden mallet to seat it as shown in **Figure 10**.



Figure 10

Arbor Removal

A drift key is included to aid in the drill chuck arbor removal.

1. Rotate the spindle handles until the slot is exposed in the side of the quill.
2. Rotate the spindle until the inner slot is aligned with the outer as shown in **Figure 11**. You will see through the spindle when the slot is properly aligned.
3. Insert the drift key into the slot and allow the quill to rise, trapping the drift key. Hold the drill chuck with one hand and tap on the drift key with a hammer as shown in **Figure 12**.

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

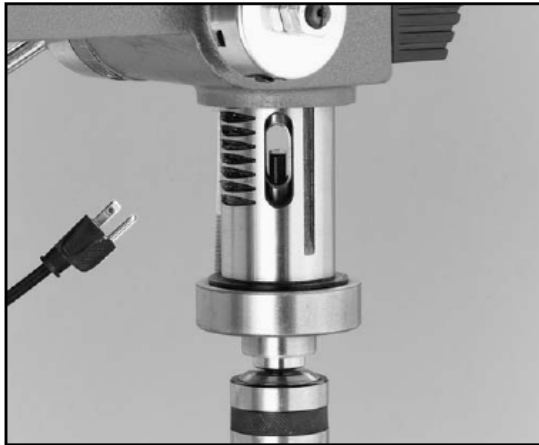


Figure 11



Figure 12

4: ADJUSTMENTS

Speed Changes

Unplug the drill press before changing speeds. The drill press has 12 speeds. There is a speed chart located under the belt guard. Refer to the chart while reading these instructions.

1. Loosen the belt tension lock knobs on both sides of the headstock by turning counterclockwise as shown in **Figure 13**.
2. The motor should be free to move. Rotate the belt tension lever counterclockwise to take tension off the V-belts as shown in **Figure 14**.
3. Locate the desired speed on the chart and move the V-belts to the desired V-grooves on the motor, idler and spindle pulleys.
4. Rotate the belt tension lever until the belts are tight. Tighten both lock knobs.
5. Close the cover.

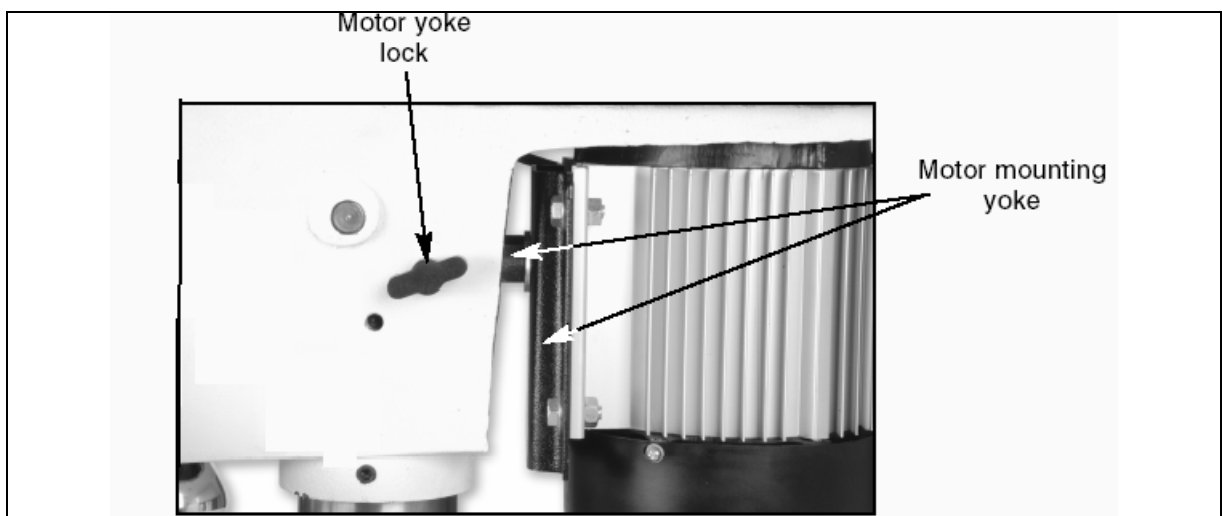


Figure 13

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

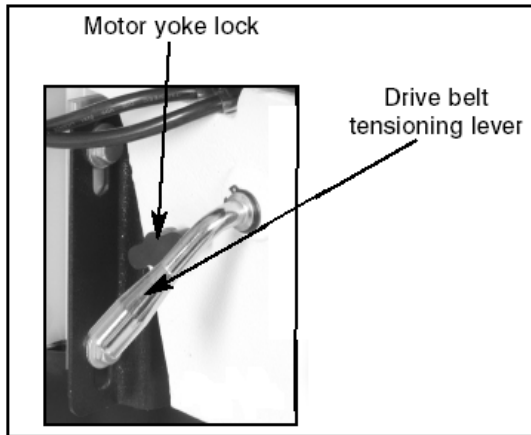


Figure 14

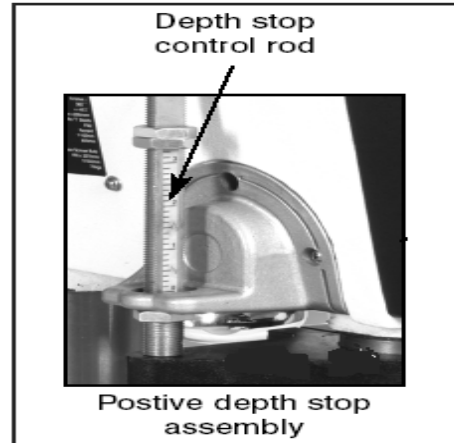


Figure 15.

Depth Stop

Your drill press comes with a depth stop adjustment for use when drilling.

This is a combination of a cast angle bracket & cover, which fits in a housing machined in the drillhead, (it mounts the bearing pocket for the end of the splined feed shaft and the return spring), the 'angle arm' of the bracket protrudes out from the drillhead parallel with the base. There is a clearance hole bored through this arm. There is a round plate casting with a triangular extrusion clamped around the outer sleeve of the quill. Within the apex of this triangle a threaded hole mounts the depth stop control rod, which also feeds up through the clearance hole in the angle arm bracket. This rod is originally threaded, which allows it to be screwed through the hole in the plate and secured in position with a lock nut. The greater part of the rod over the top of the mounting plate has been milled flat (less than radius depth) to enable a scale decal to be fitted. A nut is fitted over to the depth stop rod below the angle arm bracket (to control the 'lift' of the quill) and a nut and a lock nut fitted above the angle arm bracket to limit the 'plunge'. The graduated scale can be read over the top of the angle arm bracket and will allow the depth of the drill plunge to be measured, or set. Which as shown in **Figure 15**.

Table Adjustment

The table can be adjusted for height, rotation and angle.

1. Loosen the support bracket lock knob. Turn the table hand crank to lift or lower the table as shown in **Figure 16**.
2. Always lock the support bracket in place before operating the machine.

Adjust rotation:

1. Loosen the lock handle located under the table as shown in **Figure 17**. Rotate the table the desired amount.
2. Always lock the table rotation in place before operating the machine.

Adjust angle:

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

1. Turn the nut indicated by the arrow in **Figure 16**, in a clockwise direction. This will draw the location pin out of the casting. Once loose, pull the pin and nut out, and set it in a safe place until needed.
2. Loosen the large bolt in the center of the support bracket.
3. Rotate the bracket to the desired angle. Use the scale on the side of the bracket or a protractor to set the angle. Lock in place by tightening the bolt.

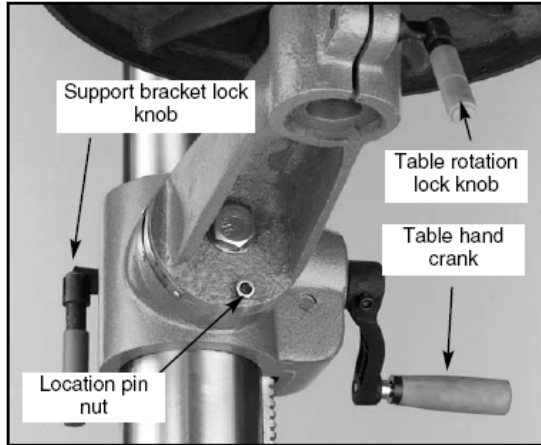


Figure 16

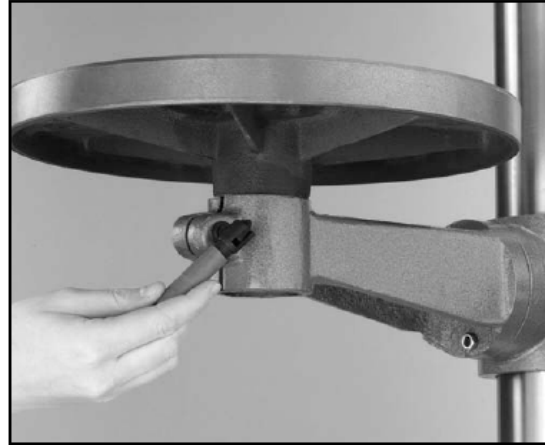


Figure 17

When repositioning the table to 0° position, loosen the large bolt in the center of the support casting. Rotate the support casting until the degree scale reads 0°. Carefully tap the location pin back into the hole from which it came until it stops. Unscrew the nut on the location pin until it is flush with the end of the threads. This will protect the threads when you tap it into place with a hammer. Turn the nut clockwise until it is snug against the casting and then tighten the large bolt in the center. The table is now set to the factory pre-set angle.

5: OPERATIONS

Test Run

Once assembly is complete and adjustments are done to your satisfaction, you are ready to test run the machine.

Turn on the power supply at the main panel. Flip the START button. Make sure that your finger is poised on the paddle switch, just in case there is a problem. The drill press should run smoothly, with little or no vibration or rubbing noises. Strange or unnatural noises should be investigated and corrected before operating the machine further.

If you cannot easily locate the source of an unusual noise or vibration, contact our service department for help.

Drill Bit Changes

Make sure to secure the bit firmly in place. When changing bits, proceed as follows:

1. Disconnect the machine from power source.

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

2. Open the chuck wide enough to accept a new bit.
3. Install the bit so the chuck jaws will grab as much of the bit shank as it can. Do not allow the chuck to grab the fluted body of the drill bit. Make sure small drill bits do not get trapped between the edges of two jaws.
4. Tighten the chuck with the chuck key using any of the three key end locations.
5. Remove the chuck key and reconnect power source.
6. Reverse steps to remove drill bit.

6: MAINTENANCE

General

Regular periodic maintenance on your drill press will ensure its optimum performance. Make a habit of inspecting your machine each time you use it. Check for the following conditions and repair or replace when necessary:

1. Loose mounting bolts.
2. Worn switch.
3. Worn or damaged cords and plugs.
4. Damaged V-belt.
5. Any other condition that could hamper the safe operation of this machine.

Tables

The nonpainted surfaces on the drill press should be protected against rust and pitting. Wiping the machine clean after every use ensures that wood dust will not trap moisture against bare metal surfaces.

Some woodworkers recommend using automotive paste wax on exposed steel and cast iron surfaces. The wax provides a layer of protection, as well as reducing friction between lumber and the table, making cuts faster and smoother. Avoid waxes that contain silicone or other synthetic ingredients. These materials can find their way into lumber that is being worked, and can make staining and finishing difficult. If you use paste wax, make sure that it is 100% Carnauba wax.

Lubrication

Inspect regularly for tension and wear. Check pulleys to ensure that they are properly aligned. See pulley/V-belt sections for proper tension and pulley alignment procedures.

V-Belt


<p>We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual</p>

Since all bearings are shielded and permanently lubricated, simply leave them alone until they need to be replaced. Do not lubricate them.

7: TECHICAL DATA


Model	Bench	ZQJ4116K	ZQJ4119K
	Floor		
Spindle Taper		MT2	MT2
Chuck (mm)		3-16mm	3-16mm
Spindle Travel		80mm	80mm
Swing(mm)		330mm/13"	356mm/14"
Speeds		12s (16s)	12s (16s)
Height	Bench	990mm	1000mm
	Floor		
Motor		See Nameplate	See Nameplate
N.W./G.W.	Bench	63/67kgs	82/86
	Floor		

WIRING DIAGRAM FOR ZQJ4116K

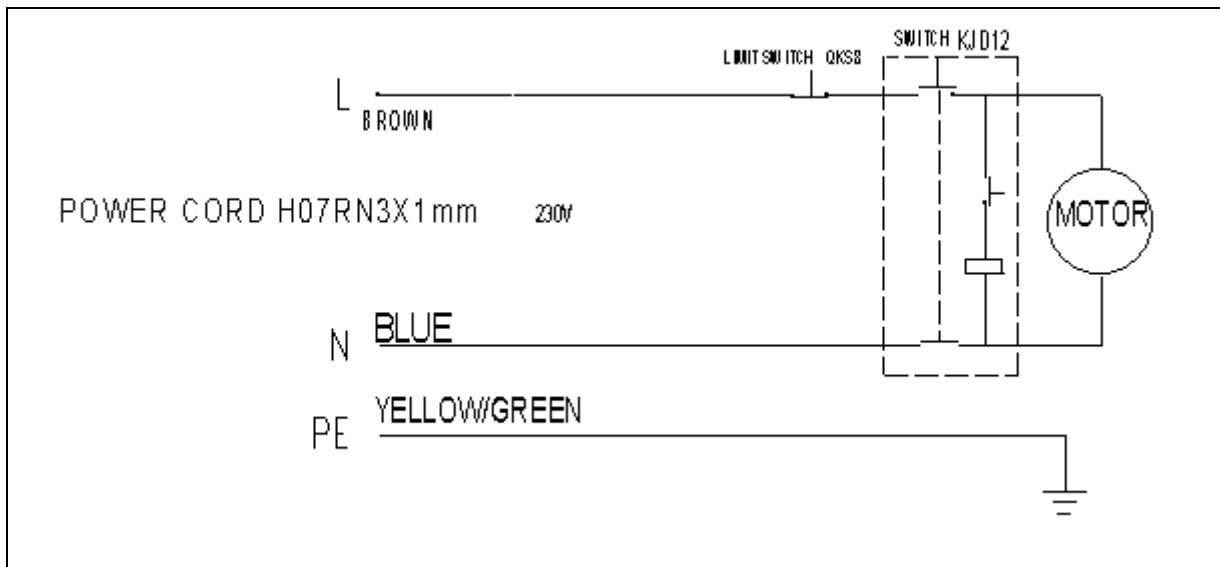

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual


WIRING DIAGRAM FOR ZQJ4119K

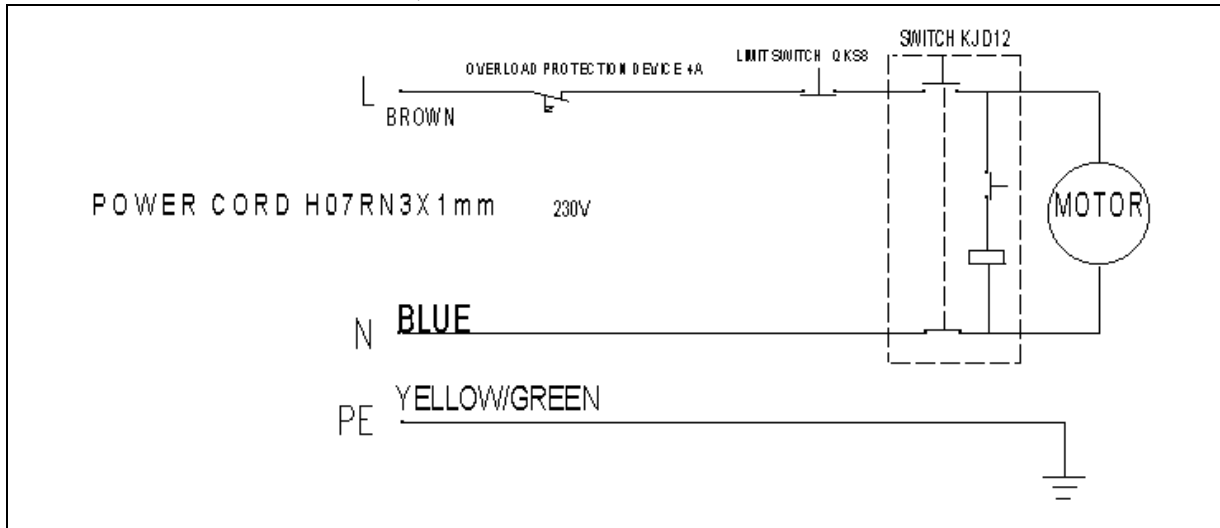

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

8: PARTS LISTS & EXPLODED VIEWS

1.ZQJ4116K

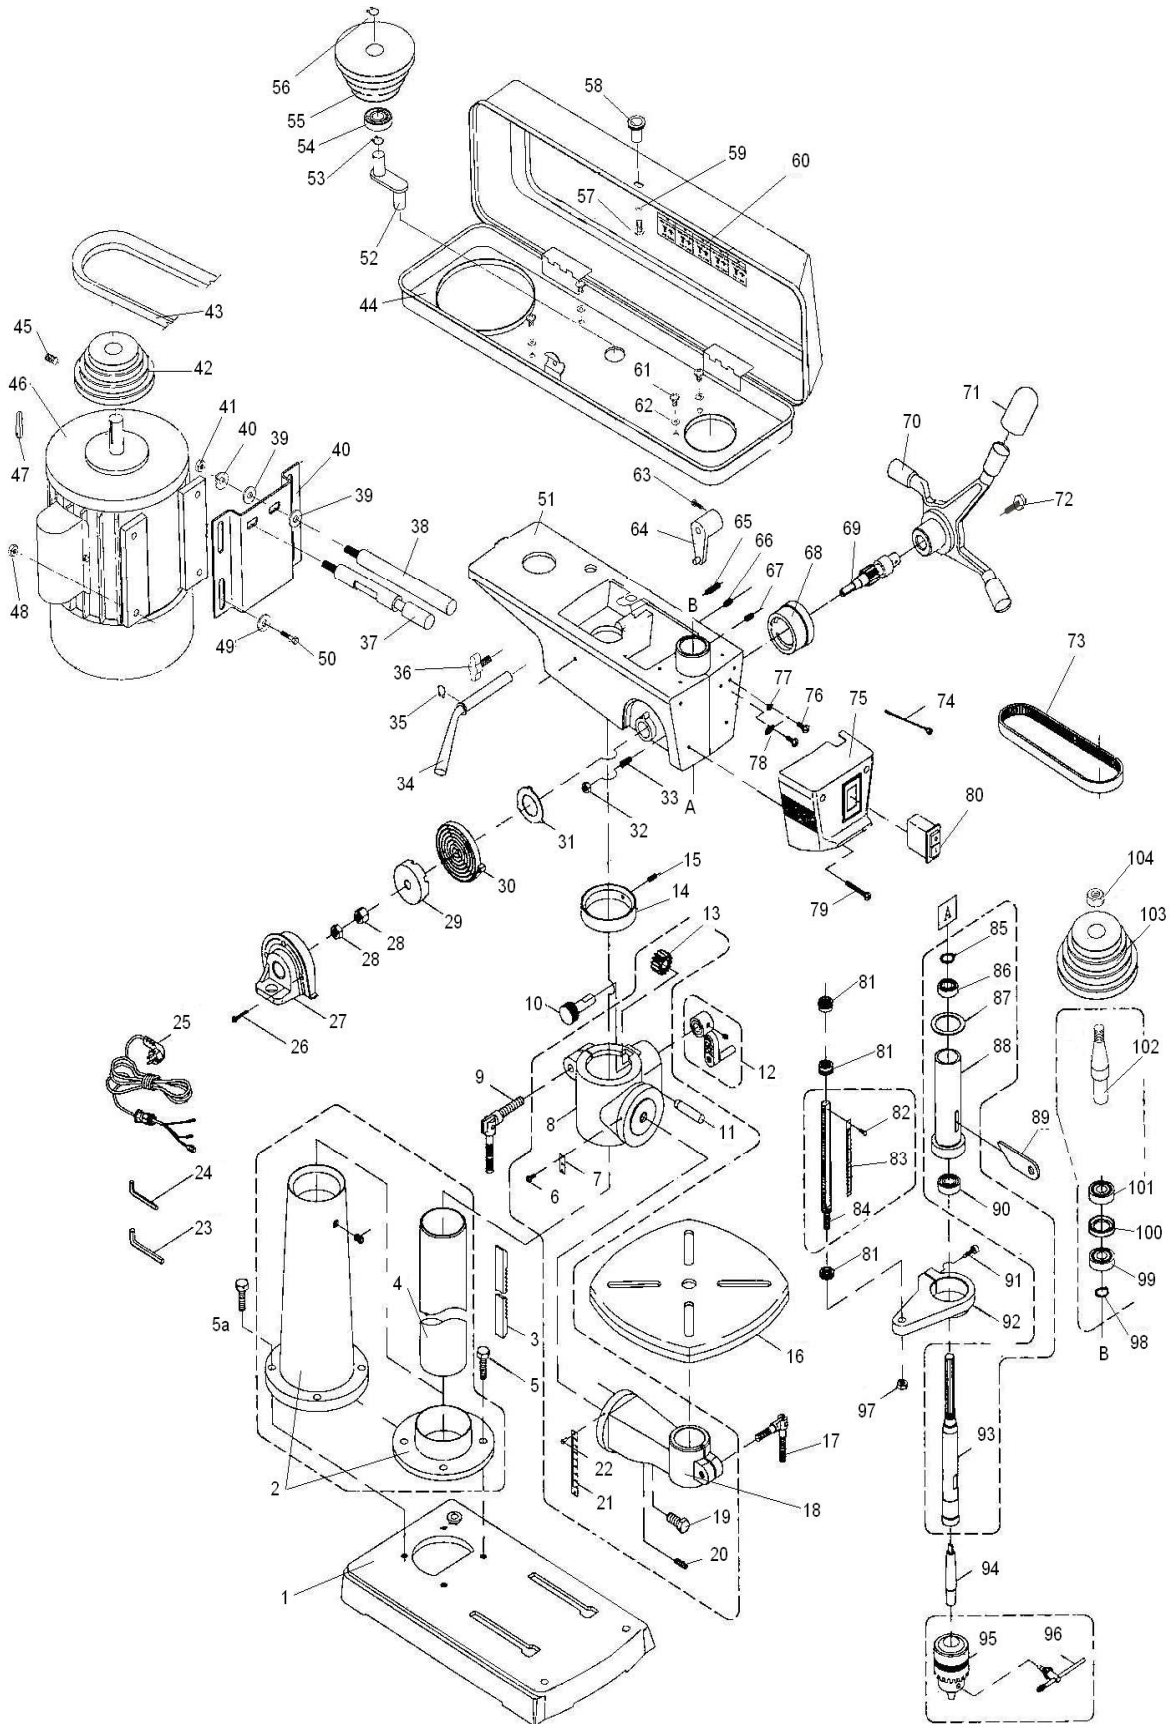

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual


PARTS LIST: ZQJ4116K DRILL PRESS

NO.	DESCRIPTION	Q'TY	NO.	DESCRIPTION	Q'TY
1	BASE	1	53	C-CLIP	1
2	COLUMN SHOULDER	1	54	BALL BEARING	1
3	RACK	1	55	CENTER PULLEY	1
4	COLUMN	1	56	C-CLIP	1
5	HEX BOLT	4	57	SCREW	1
6	SCREW	2	58	KNOB	1
7	MARK	1	59	WASHER	1
8	TABLE BRACKET	1	60	SPEED CHART LABEL	1
9	CLAMP BOLT	1	61	SCREW	4
10	WORM GEAR	1	62	WASHER	4
11	SHAFT	1	63	HEX BOLT	1
12	HANDLE	1	64	SHIFTER	1
13	GEAR	1	65	SET SCREW	1
14	RACK RING	4	66	SET SCREW	1
15	SET SCREW	1	67	SET SCREW	2
16	TABLE	1	68	DEPTH RING	1
17	TABLE BOLT	1	69	FEED SHAFT	1
18	TABLE ARM BRACKET	1	70	HANDLE	1
19	HEX BOLT	2	71	HANDLE COVER	1
20	PIN	1	72	CAP BOLT	1
21	MARK	1	73	V-BELT	1
22	SCREW	2	74	SCREW	2
23	WRENCH 5mm	1	75	SWITCH BOX	1
24	WRENCH 3mm	1	76	SCREW	2
25	POWER CORD	1	77	WASHER	2
26	SCREW	3	78	WASHER	1
27	COVER	1	79	SCREW	2
28	NUT	2	80	SWITCH	1
29	SPRING CAP	1	81	NUT	3
30	TORSION SPRING	1	82	SCREW	2
31	SPRING COVER	1	83	SCALE	1
32	NUT	1	84	SCALE BASE	1
33	SCREW SPECIAL SET	1	85	C--CLIP	1
34	SHIFTER BAR	1	86	BALL BEARING	1
35	C-CLIP	1	87	RUBBER WASHER	1
36	SLIDE BAR BOLT	2	88	SPINDLE SLEEVE	1
37	SLIDE BAR	1	89	WEDGE	1
38	SLIDE BAR	1	90	BALL BEARING	1
39	WASHER	2	91	CAP BOLT	1
40	MOTOR BASE	2	92	PLATE	1
41	NUT	2	93	SPINDLE	1
42	MOTOR PULLEY	1	94	ARBOR	1
43	V-BELT	1	95	CHUCK	1
44	PULLEY COVER	1	96	CHUCK KEY	1
45	SET SCREW	1	97	NUT	1
46	MOTOR	1	98	C--CLIP	1
47	KEY	1	99	BALL BEARING	1
48	NUT	4	100	SPACER	1
49	WASHER	4	101	BALL BEARING	1
50	HEX BOLT	4	102	INSERT PULLEY	1
51	BODY	1	103	SPINDLE PULLEY	
52	CENTER SHAFT	1	104	PULLEY NUT	1

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

2. ZQJ4119K

Please Note: Some parts of the drawing below are mirrored for clarity

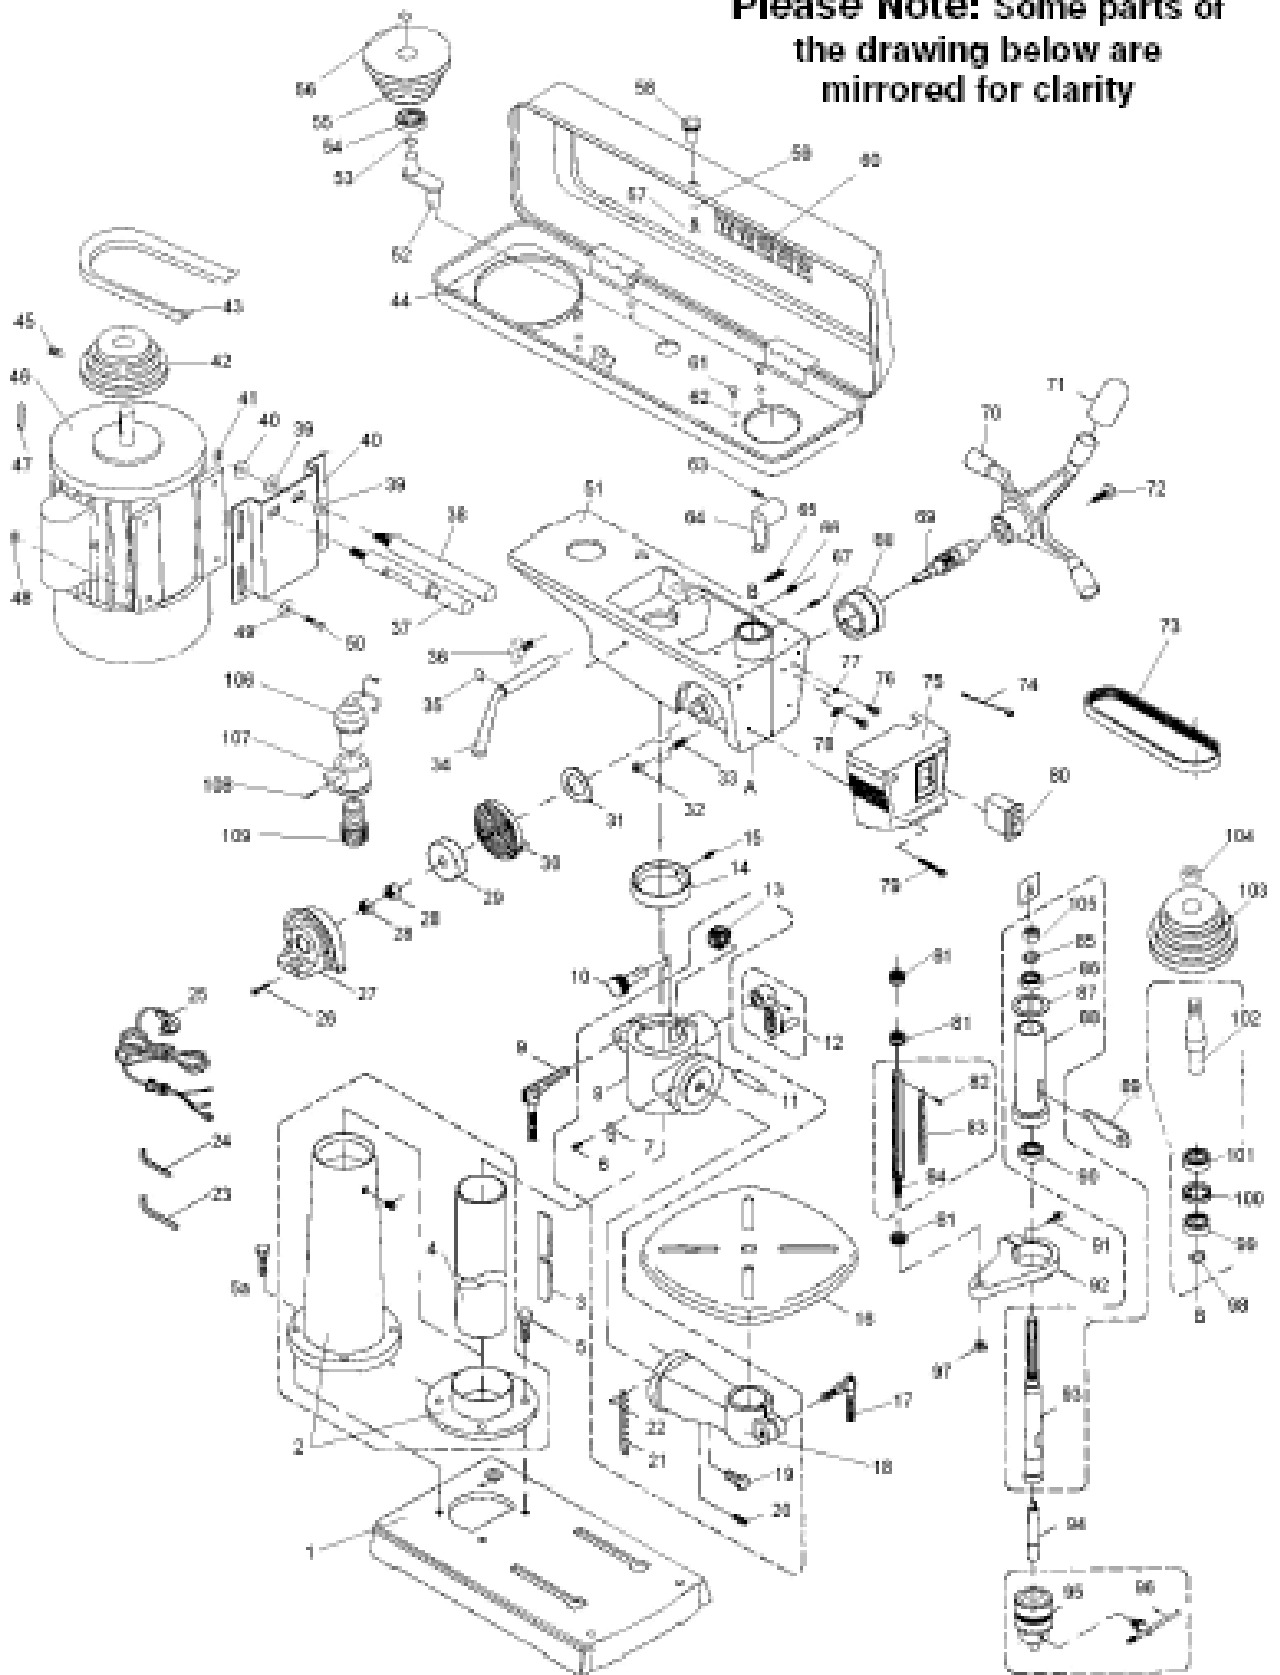

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

PARTS LIST: ZQJ4119K DRILL PRESS

Illustrated Parts Catalogue of the Drill Press

Ref No	Description	Unit	QTY	Ref No	Description	Unit	QTY
1	BASE		1	33	SCREW SPECIAL SET		1
2	COLUMN SHOULDER		1	34	SHIFTER BAR		1
3	RACK		1	35	C-CLIP		1
4	COLUMN		1	36	SLIDE BAR BOLT		2
5	HEX BOLT		4	37	SLIDE BAR		1
6	SCREW		2	38	SLIDE BAR		1
7	MARK		1	39	WASHER		2
8	TABLE BRACKET		1	40	MOTOR BASE		2
9	CLAMP BOLT		1	41	NUT		2
10	WORM GEAR		1	42	MOTOR PULLEY		1
11	SHAFT		1	43	V-BELT		1
12	HANDLE		1	44	PULLEY COVER		1
13	GEAR		1	45	SET SCREW		1
14	RACK RING		4	46	MOTOR		1
15	SET SCREW		1	47	KEY		1
16	TABLE		1	48	NUT		4
17	TABLE BOLT		1	49	WASHER		4
18	TABLE ARM BRACKET		1	50	HEX BOLT		4
19	HEX BOLT		2	51	BODY		1
20	PIN		1	52	CENTER SHAFT		1
21	MARK		1	53	C-CLIP		1
22	SCREW		2	54	BALL BEARING		1
23	WRENCH 5mm		1	55	CENTER PULLEY		1
24	WRENCH 3mm		1	56	C-CLIP		1
25	POWER CORD		1	57	SCREW		1
26	SCREW		3	58	KNOB		1
27	COVER		1	59	WASHER		1
28	NUT		2	60	SPEED CHART LABEL		1
29	SPRING CAP		1	61	SCREW		4
30	TORSION SPRING		1	62	WASHER		4
31	SPRING COVER		1	63	HEX BOLT		1
32	NUT		1	64	SHIFTER		1

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

Illustrated Parts Catalogue of the Drill Press (Continued)

Ref			Ref			
No	Description	Unit	QTY	No	Description	
					Unit	
					QTY	
65	SET SCREW		1	97	NUT	1
66	SET SCREW		1	98	C-CLIP	1
67	SET SCREW		2	99	BALL BEARING	1
68	DEPTH RING		1	100	SPACER	1
69	FEED SHAFT		1	101	BALL BEARING	1
70	HANDLE		1	102	INSERT PULLEY	1
71	HANDLE COVER		1	103	SPINDLE PULLEY	
72	CAP BOLT		1	104	PULLEY NUT	1
73	V-BELT		1	105	NUT	1
74	SCREW		2	106	LIGHT BODY	1
75	SWITCH BOX		1	107	LIGHT BASE	1
76	SCREW		2	108	SCREW	1
77	WASHER		2	109	LIGHT SCREW	1
78	WASHER		1			
79	SCREW		2			
80	SWITCH		1			
81	NUT		2			
82	SCREW		2			
83	SCALE		1			
84	SCALE BASE		1			
85	C-CLIP		1			
86	BALL BEARING		1			
87	RUBBER WASHER		1			
88	SPINDLE SLEEVE		1			
89	WEDGE		1			
90	BALL BEARING		1			
91	CAP BOLT		1			
92	PLATE		1			
93	SPINDLE		1			
94	ARBOR		1			
95	CHUCK		1			
96	CHUCK KEY		1			

We reserve the right of the amendment addition and deletion of the specifications, explanatory wording, etc. printed in this manual

NOTES



Distributed by:

AUSTRALIA:

Garrick Herbert Pty Ltd
Kirrawee, NSW
www.garrickherbert.com.au

NEW ZEALAND:

R.R. Bramley & Co Ltd
Auckland
www.bramley.co.nz

USA:

Garrick USA LLC
Winona, Mn
www.GarrickUSA.com